
## **Stewart Connector**

## <u>36 SERIES SHIELDED PLUG WITH –A161 MANAGEMENT BAR ASSEMBLY</u> <u>INSTRUCTIONS</u>


Assembly steps 1 – 12:

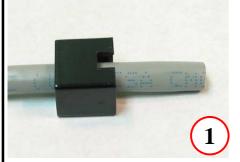


Slide strain relief over cable



Remove 1" to 2" of cable jacket

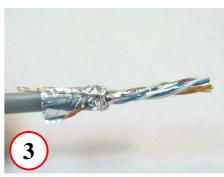


Fold back shield and drain wire

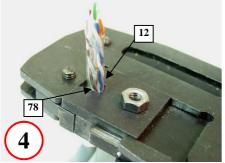

Slide ferrule over end of jacket and shield and crimp. Pairs 12 and 78 go to the sides




Remove excess shield. Also remove plastic foil insulation if present

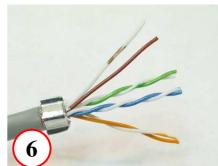


Spread apart pairs and straighten



Align pairs (568-B shown) and trim at an angle

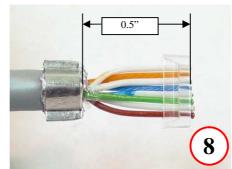

Slide wires into –A161 management bar. Trim off at approx. 0.5" from ferrule

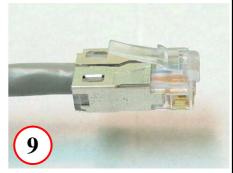

Place wires into plug housing


#### 36 SERIES SHIELDED PLUG W/-A161 MANAGEMENT BAR ASSEMBLY INSTRUCTIONS

11118 Susquehanna Trail South Glen Rock, PA 17327

# **Stewart Connector**

### <u>36 SERIES SHIELDED PLUG WITH –A161 MANAGEMENT BAR ASSEMBLY</u> <u>INSTRUCTIONS</u>

Assembly steps 1 – 12 (Cont.):

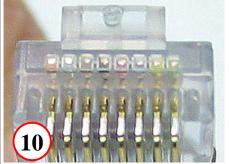

Verify wire ends are visible through plug housing



Terminate plug housing onto cable



Slide strain relief over housing. Assembly is now complete

MN360016-A1